



NOTES:

- 1. SIDESILL REPAIR TO BE COMPLETED IN SECTIONS NOT EXCEEDING 20' AT A TIME.
- 2. AREA OF SIDESILL REPAIR MUST BE SUPPORTED WITH JACKS SUPPORTING SIDESILL STRUCTURE SPACED NOT MORE THAN 4' OC TO PREVENT LOSS OF CARBODY CAMBER DURING REPAIR.
- JACKS SHOULD BE PLACED AT ALL FOUR CORNERS OF CAR TO BALANCE CAR 3. LATERALLY.
- 4. ANY DAMAGE CAUSED TO THE SIDESILL DURING SHEETING REMOVAL MUST BE FILLED WITH CLEAN WELD MATERIAL AND GROUND SMOOTH TO RESTORE ORIGINAL SIDESILL THICKNESS.
- 5. AFTER SIDE SHEET REMOVAL, SIDESILL CORROSION MUST BE REMOVED WITH GRIT BLASTING TO WHITE METAL SURFACE THEN PAINTED WITH WELD-THROUGH PRIMER PRIOR TO REPLACING SHEETING.
- 6. LOWER VESTIBULE DOOR EXTERIOR SHEETING TO BE REMOVED AND REPLACED TO OEM SPECS AND DIMENSIONS AS SHOWN IN ATTACHED OEM DRAWING 115492, WITH THE EXCEPTION OF REPLACEMENT DOOR INSULATION TO BE 1 1/4" MINERAL WOOL BATT INSTEAD OF FIBERGLASS.

MOTIVE POWER AND EQ PASSENGER COAC	HES
ARR 205-210 PAINT AND DETAILS AND NOT	
Image: Constraint of the second sec	DWG NO. 2 OF 3

